



## SERVICE BULLETIN SB271107

### ICON CONTAINER GROMMET INSPECTION Issue Date : November 27. 2007

Status : Precautionary


Identification: All ICON Harness/Container.  
Part Number: P120  
Manufactured After and Including 01 September 2007  
Serial Numbers:

Background: A report back from the field revealed that there were some damaged Grommets on an ICON Container. The ICON was returned to the manufacturer where it was determined that the Grommets had been damaged by the Grommet Press.


The Damage can be seen on the inside of the Grommet where the Closing Tool has scratched the Inside Surface of the Grommet. The seating of the Grommet needs to be inspected to ensure correct and flush seating of the Grommet.

This could well be an isolated incident, but as a matter of precaution Aerodyne is recommending all Grommets on the ICONs listed in the Identification paragraph above be Inspected.

#### Pictures:

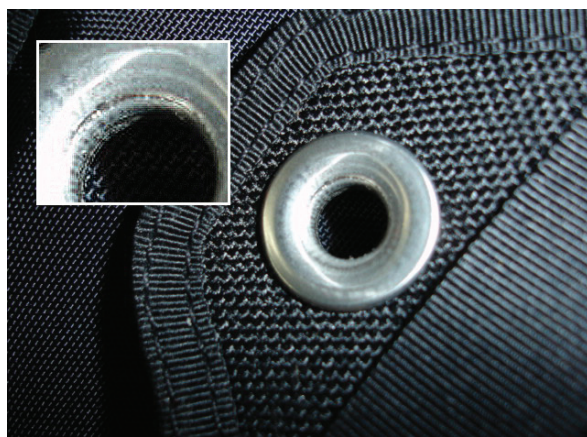

1. Damaged Grommet  
see damage on inner ring of grommet

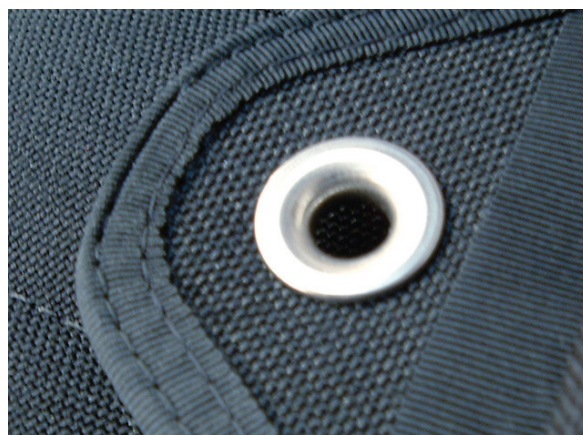

1. Undamaged Grommet



## SERVICE BULLETIN SB271107

**ICON CONTAINER GROMMET INSPECTION**  
**Issue Date : November 27. 2007**

**Authority:**

Dominic Hayhurst  
Technical Director  
Aerodyne Research  
12649 Race Track Road  
Tampa Florida 33626 USA  
Tel +1 813 891 6300  
dominic@flyaerodyne.com  
www.flyaerodyne.com

**Distribution List:**

1. Aerodyne Website [www.flyaerodyne.com](http://www.flyaerodyne.com)
2. All Aerodyne Distributors
3. PIA Technical and Rigging Committee
4. FPF – French Parachute Federation